

TELEVISION TECHNICAL BULLETIN

Page 1 of 1

MODELS 37AM12H 37AM23H 37AT25H

SYMPTOM Q601 fails occasionally.

CAUSE Noise spikes on the drive signal to Q601.

ACTION Fit D619 and R632 as shown in the diagram below, on the print side of the main PWB, ensuring that no component shorts out.

Also change C713 to 1000uF, 16V.

Use the part numbers given below.

<u>REF NO</u>	<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>PRICE CODE</u>
D619	Diode	RH-DX0045BMZZ	AA
R632	Resistor 470R, 0.5W	VRD-RA2HD471J	AA
C713	Capacitor, 1000uF, 16V	VCEAGA1CW108M	AD

